SUMMARY REPORT
59 WEST CARDINAL LANE (FORMERLY 1204 WEST CARDINAL LANE)
LAUREL BAY MILITARY HOUSING AREA
MARINE CORPS AIR STATION BEAUFORT
BEAUFORT, SC

Revision: 0 Prepared for:

Department of the Navy Naval Facilities Engineering Command, Mid-Atlantic 9324 Virginia Avenue Norfolk, Virginia 23511-3095

and



Naval Facilities Engineering Command Atlantic 9324 Virginia Avenue Norfolk, Virginia 23511-3095 SUMMARY REPORT
59 WEST CARDINAL LANE (FORMERLY 1204 WEST CARDINAL LANE)
LAUREL BAY MILITARY HOUSING AREA
MARINE CORPS AIR STATION BEAUFORT
BEAUFORT, SC

Revision: 0 Prepared for:

Department of the Navy Naval Facilities Engineering Command, Mid- Atlantic 9324 Virginia Avenue Norfolk, Virginia 23511-3095

and



Naval Facilities Engineering Command Atlantic

9324 Virginia Avenue Norfolk, Virginia 23511-3095 Prepared by:



CDM - AECOM Multimedia Joint Venture 10560 Arrowhead Drive, Suite 500 Fairfax, Virginia 22030

Contract Number: N62470-14-D-9016

CTO WE52

**JUNE** 2021



### **Table of Contents**

1.0 1.1 1.2	Backgroui	TION  ND INFORMATION  VAL AND ASSESSMENT PROCESS	1
2.0		ACTIVITIES AND RESULTS	
2.1 2.2		VAL AND SOIL SAMPLING	
3.0	PROPERTY	STATUS	4
4.0	REFERENC	ES	4
Table	1	Table  Laboratory Analytical Results - Soil  Appendices	
Appen Appen Appen	dix B	Multi-Media Selection Process for LBMH UST Assesment Report Regulatory Correspondence	





### List of Acronyms

bgs below ground surface

BTEX benzene, toluene, ethylbenzene, and xylenes

CTO Contract Task Order

COPC constituents of potential concern

IDIQ Indefinite Delivery, Indefinite Quantity

IGWA Initial Groundwater Assessment

JV Joint Venture

LBMH Laurel Bay Military Housing MCAS Marine Corps Air Station

NAVFAC Mid-Lant Naval Facilities Engineering Command Mid-Atlantic

NFA No Further Action

PAH polynuclear aromatic hydrocarbon

QAPP Quality Assurance Program Plan

RBSL risk-based screening level

SCDHEC South Carolina Department of Health and Environmental Control

Site LBMH area at MCAS Beaufort, South Carolina

UST underground storage tank

VISL vapor intrusion screening level



#### 1.0 INTRODUCTION

The CDM - AECOM Multimedia Joint Venture (JV) was contracted by the Naval Facilities Engineering Command, Mid-Atlantic (NAVFAC Mid-Lant) to provide reporting services for the heating oil underground storage tanks (USTs) located in Laurel Bay Military Housing (LBMH) area at the Marine Corps Air Station (MCAS) Beaufort, South Carolina (Site). This work has been awarded under Contract Task Order (CTO) WE52 of the Indefinite Delivery, Indefinite Quantity (IDIQ) Multimedia Environmental Compliance Contract (Contract No. N62470-14-D-9016).

As of January 2014, the LBMH addresses were re-numbered to comply with the E-911 emergency response addressing system; however, in order to remain consistent with historical sampling and reporting for LBMH area, the residences will continue to be referenced with their original address numbers in sample nomenclature and reporting documents.

This report summarizes the results the environmental investigation activities associated with the storage of home heating oil and the potential release of petroleum constituents at the referenced property. Based on the results of the investigation, a No Further Action (NFA) determination has been made by the South Carolina Department of Health and Environmental Control (SCDHEC) for 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane). This NFA determination indicates that there are no unacceptable risks to human health or the environment for the petroleum constituents associated with the home heating oil USTs. The following information is included in this report:

- Background information;
- Sampling activities and results; and
- A determination of the property status.

### 1.1 Background Information

The LBMH area is located approximately 3.5 miles west of MCAS Beaufort. The area is approximately 970 acres in size and serves as an enlisted and officer family housing area. The area is configured with single family and duplex residential structures, and includes recreation, open space, and community facilities. The community includes approximately 1,300 housing units, including legacy Capehart style homes and newer duplex style homes. The housing area



is bordered on the west by salt marshes and the Broad River, and to the north, east and south by uplands. Forested areas lie along the northern and northeastern borders.

Capehart style homes within the LBMH area were formerly heated using heating oil stored in USTs at each residence. There were 1,100 Capehart style housing units in the LBMH area. The newer duplex homes within the LBMH area never utilized heating oil tanks. Heating oil has not been used at Laurel Bay since the mid-1980s. As was the accepted practice at the time, USTs were drained, filled with dirt, capped, and left in place when they were removed from service. Residential USTs are not regulated in the State of South Carolina (i.e., there are no federal or state laws governing installation, management, or removal).

In 2007, MCAS Beaufort began a voluntary program to remove the unregulated, residential USTs and conduct sampling activities to determine if, and to what extent, petroleum constituents may have impacted the surrounding environment. MCAS Beaufort coordinated with SCDHEC to develop removal procedures that were consistent with procedural requirements for regulated USTs. All tank removal activities and follow-on actions are conducted in coordination with SCDHEC. To date, all known USTs have been removed from all residential properties within the LBMH area.

### 1.2 UST Removal and Assessment Process

During the UST removal process, a soil sample was collected from beneath the UST excavations (approximately 4 to 6 feet [ft] below ground surface [bgs]) and analyzed for a predetermined list of constituents of potential concern (COPCs) associated with the petroleum compounds found in home heating oil. These COPCs, derived from the *Quality Assurance Program Plan (QAPP) for the Underground Storage Tank Management Division, Revision 3.1* (SCDHEC, 2016) and the *Underground Storage Tank Assessment Instructions for Permanent Closure and Change-In-Service,* (SCDHEC, 2018), are as follows:

- benzene, toluene, ethylbenzene, and xylenes (BTEX),
- naphthalene, and
- five select polynuclear aromatic hydrocarbon (PAHs): benzo(a)anthracene, benzo(b)fluoranthene, benzo(k)fluoranthene, chrysene and dibenz(a,h)anthracene.

Soil sample results were submitted by MCAS Beaufort to SCDHEC utilizing SCDHEC's UST Assessment Report form. In accordance with SCDHEC's *QAPP for the UST Management Division* 



(SCDHEC, 2016), the soil screening levels consists of SCDHEC risk-based screening levels (RBSLs). It should be noted that the RBSLs for select PAHs were revised in Revision 2.0 of the QAPP (SCDHEC, 2013) and were revised again in Revision 3.0 (SCDHEC, 2015). The screening levels used for evaluation at each site were those levels that were in effect at the time of reporting and review by SCDHEC.

The results of the soil sampling at each former UST location were used to determine if a potential for groundwater contamination exists (i.e., soil results greater than RBSLs) and subsequently to select properties for follow-up initial groundwater assessment (IGWA) sampling. The results of the IGWA sampling (if necessary) are used to determine the presence or absence of the aforementioned COPCs in groundwater and identify whether former UST locations will require additional delineation of COPCs in groundwater. In order to delineate the extent of impact to groundwater, permanent wells are installed and a sampling program is established for those former UST locations where IGWA sampling has indicated the presence of COPCs in excess of the SCDHEC RBSLs for groundwater. Groundwater analytical results are also compared to the site specific groundwater vapor intrusion screening levels (VISLs) to evaluate the potential for vapor intrusion and the necessity for an investigation associated with this media. A multi-media investigation selection process tree, applicable to the LBMH UST investigations, is presented as Appendix A.

#### 2.0 SAMPLING ACTIVITIES AND RESULTS

The following section presents the sampling activities and associated results for 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane). Details regarding the soil investigation at this site are provided in the *SCDHEC UST Assessment Report – 1204 West Cardinal Lane* (MCAS Beaufort, 2014). The UST Assessment Report is provided in Appendix B.

### 2.1 UST Removal and Soil Sampling

On June 18, 2013, a single 280 gallon heating oil UST was removed from the front yard under the driveway area at 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane). The former UST location is indicated on Figures 2 and 3 of the UST Assessment Report (Appendix B). The UST was removed and properly disposed of (i.e., shipped offsite for recycling or transported to a landfill). There was no visual evidence (i.e., staining or sheen) of petroleum impact at the time of the UST removal. According to the UST Assessment Report (Appendix B), the depth to the



base of the UST was 6'0" bgs and a single soil sample was collected from that depth. The sample was collected from the fill port side of the former UST to represent a worst case scenario.

Following UST removal, a soil sample was collected from the base of the excavation and shipped to an offsite laboratory for analysis of the petroleum COPCs. Sampling was performed in accordance with applicable South Carolina regulation R.61-92, Part 280 (SCDHEC, 2017) and assessment guidelines.

### 2.2 Soil Analytical Results

A summary of the laboratory analytical results and SCDHEC RBSLs is presented in Table 1. A copy of the laboratory analytical data report is included in the UST Assessment Report presented in Appendix B. The laboratory analytical data report includes the soil results for the additional PAHs that were analyzed, but do not have associated RBSLs.

The soil sample results were submitted by MCAS Beaufort to SCDHEC utilizing SCDHEC's UST Assessment Report form (Appendix B). The results of the soil sampling at the former UST location were used by MCAS Beaufort, in consultation with SCDHEC, to determine a path forward (i.e., additional sampling or NFA) for the property. The soil results collected from 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane) were less than the SCDHEC RBSLs, which indicated the subsurface was not impacted by COPCs associated with the former UST at concentrations that presented a potential risk to human health and the environment.

#### 3.0 PROPERTY STATUS

Based on the analytical results for soil, SCDHEC made the determination that NFA was required for 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane). This NFA determination was obtained in a letter dated July 1, 2015. SCDHEC's NFA letter is provided in Appendix C.

#### 4.0 REFERENCES

Marine Corps Air Station Beaufort, 2014. South Carolina Department of Health and Environmental Control (SCDHEC) Underground Storage Tank Assessment Report – 1204 West Cardinal Lane, Laurel Bay Military Housing Area, March 2014.

South Carolina Department of Health and Environmental Control Bureau of Land and Waste Management, 2013. *Quality Assurance Program Plan for the Underground Storage Tank Management* Division, *Revision 2.0*, April 2013.



- South Carolina Department of Health and Environmental Control Bureau of Land and Waste Management, 2015. *Quality Assurance Program Plan for the Underground Storage Tank Management* Division, *Revision 3.0*, May 2015.
- South Carolina Department of Health and Environmental Control Bureau of Land and Waste Management, 2016. *Quality Assurance Program Plan for the Underground Storage Tank Management* Division, *Revision 3.1*, February 2016.
- South Carolina Department of Health and Environmental Control Bureau of Land and Waste Management, 2017. *R.61-92, Part 280, Underground Storage Tank Control Regulations*, March 2017.
- South Carolina Department of Health and Environmental Control Bureau of Land and Waste Management, 2018. *Underground Storage Tank Assessment Instructions for Permanent Closure and Change-In-Service*, March 2018.

### **Table**



#### Table 1

### Laboratory Analytical Results - Soil 59 West Cardinal Lane (Formerly 1204 West Cardinal Lane)

### Laurel Bay Military Housing Area Marine Corps Air Station Beaufort Beaufort, South Carolina

Constituent	SCDHEC RBSLs (1)	Results Sample Collected 06/18/13
Volatile Organic Compounds Analyze	d by EPA Method 8260B (mg/kg)	'
Benzene	0.003	ND
Ethylbenzene	1.15	ND
Naphthalene	0.036	ND
Toluene	0.627	ND
Xylenes, Total	13.01	ND
Semivolatile Organic Compounds An	alyzed by EPA Method 8270D (mg/kg)	)
Benzo(a)anthracene	0.66	0.0990
Benzo(b)fluoranthene	0.66	0.104
Benzo(k)fluoranthene	0.66	0.0519
Chrysene	0.66	0.0744
Dibenz(a,h)anthracene	0.66	ND

#### **Notes:**

Bold font indicates the analyte was detected.

Bold font and shading indicates the concentration exceeds the SCDHEC RBSL.

EPA - United States Environmental Protection Agency

mg/kg - milligram per kilogram

ND - not detected at the reporting limit (or method detection limit if shown on the laboratory report). The laboratory report is provided in Appendix B.


RBSL - Risk-Based Screening Level

SCDHEC - South Carolina Department Of Health and Environmental Control

<sup>&</sup>lt;sup>(1)</sup> South Carolina Risk-Based Screening Levels from the Quality Assurance Program Plan for the Underground Storage Tank Management Division, Revision 3.0 and 3.1 (SCDHEC, May 2015 and SCDHEC, February 2016) and the Underground Storage Tank Assessment Guidelines (SCDHEC, February 2006).

# Appendix A Multi-Media Selection Process for LBMH



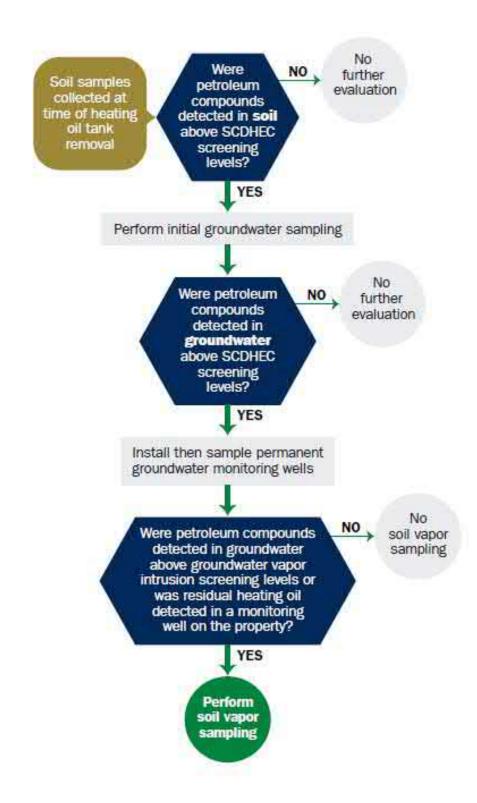


**Appendix A - Multi-Media Selection Process for LBMH** 

# Appendix B UST Assessment Report



## South Carolina Department of Health and Environmental Control (SCDHEC) Underground Storage Tank (UST) Assessment Report

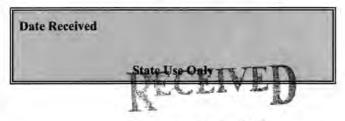

Submit Completed Form To: UST Program SCDHEC 2600 Bull Street Columbia, South Carolina 29201 Telephone (803) 896-7957

MAR 1 9 2014

SC DHEC - Bureau of Land & Waste Management

I. OWNERSHIP OF UST (S)

MCAS Beaufort, Commanding Officer Attn: NREAO (Craig Ehde) Owner Name (Corporation, Individual, Public Agency, Other) P.O. Box 55001 Mailing Address Beaufort, South Carolina 29904-5001 City State Zip Code 228-7317 Craig Ehde 843 Telephone Number Area Code Contact Person

### II. SITE IDENTIFICATION AND LOCATION

D 41	Б. #									
Permit I.		4 % 0.000	**********	7				a	BU San Francis	
Laure	I Bay Mil	itary	Housing A	Area,	Marine	Corps	Air	Station	, Beaufort	, SC
Facility N	Name or Com	pany Site	e Identifier							
				100	6 V	600				
1204	Cardinal	Lane,	Laurel B	Bay Mi	litary	Housin	ig Are	a		
Street Ac	ddress or State	e Road (a	is applicable)	)						
Beauf	fort,		Веа	ufort						
City			Co	ounty						

Attachment 2

### III. INSURANCE INFORMATION

	III. II.OUX	unice mi ominimon
	Insura	nce Statement
qualify to receive state monies	s to pay for appropriate fund, written confirmate	at Permit ID Number may te site rehabilitation activities. Before participation is ation of the existence or non-existence of an environmental completed.
Is there now, or has the UST release? YES_		ance policy or other financial mechanism that covers this one)
If you answered	d YES to the above qu	uestion, please complete the following information:
	My policy provider is	
	My policy provider is	is:
	The policy limit is:	45
	serial Expert A strange serial	
If you have this type o	f insurance, please inc	clude a copy of the policy with this report.
	IV. REQUES	T FOR SUPERB FUNDING
I DO/DO NOT wi	sh to participate in the	e SUPERB Program. (Circle one.)
- V.	CERTIFICATION	N (To be signed by the UST owner)
I certify that I have persona attached documents; and the information, I believe that the	ally examined and an nat based on my inquestion ne submitted informa	n familiar with the information submitted in this and all quiry of those individuals responsible for obtaining this ation is true, accurate, and complete.
Name (Type or print.)		
Signature		
To be completed by No	otary Public:	
Sworn before me this	day of	, 20
(Name)		
M NIC A A		
Notary Public for the state of_ Please affix State seal if you a	re commissioned outs	ide South Carolina

VI. UST INFORMATION	1204 Cardinal
Product(ex. Gas, Kerosene)	Heating oil
Capacity(ex. 1k, 2k)	280 gal
Age	Late 1950s
Construction Material(ex. Steel, FRP)	Steel
Month/Year of Last Use	Mid 80s
Depth (ft.) To Base of Tank	6 '
Spill Prevention Equipment Y/N	No
Overfill Prevention Equipment Y/N	No
Method of Closure Removed/Filled	Removed
Date Tanks Removed/Filled	6/18/2013
Visible Corrosion or Pitting Y/N	Yes
Visible Holes Y/N	Yes
Method of disposal for any USTs removed from th UST 1204Cardinal was removed from	
at a Subtitle "D" landfill. See	Attachment "A".
Method of disposal for any liquid petroleum, sludg disposal manifests) UST 1204Cardinal was previously	

### VII. PIPING INFORMATION

	1204 Cardinal
	Steel
Construction Material(ex. Steel, FRP)	& Copper
Distance from UST to Dispenser	N/A
Number of Dispensers	N/A
Type of System Pressure or Suction	Suction
Was Piping Removed from the Ground? Y/N	ио по
Visible Corrosion or Pitting Y/N	Yes
Visible Holes Y/N	No
Age	Late 1950s
	ved, describe the location and extent for each pi
	found on the surface of the steel turn lines were sound.
	SCRIPTION AND HISTORY
The HISTs at the residences a	te constructed of studie wall st
The USTs at the residences as	oil for heating. These USTs were
and formerly contained fuel	oil for heating. These USTs were and last used in the mid 1980s.
and formerly contained fuel	oil for heating. These USTs were and last used in the mid 1980s.
and formerly contained fuel	그리고 있는데 그리고 있는데 요즘에 가는 가지 않는데 되었다면 하는데 하는데 하는데 하다 하는데 하다.
and formerly contained fuel	그리고 있는데 그리고 있는데 요즘에 가는 가지 않는데 되었다면 하는데 하는데 하는데 하다 하는데 하다.

### IX. SITE CONDITIONS

	Yes	No	Unk
A. Were any petroleum-stained or contaminated soils found in the UST excavation, soil borings, trenches, or monitoring wells?  If yes, indicate depth and location on the site map.		х	
B. Were any petroleum odors detected in the excavation, soil borings, trenches, or monitoring wells?  If yes, indicate location on site map and describe the odor (strong, mild, etc.)		х	
C. Was water present in the UST excavation, soil borings, or trenches?  If yes, how far below land surface (indicate location and depth)?		Х	
D. Did contaminated soils remain stockpiled on site after closure?  If yes, indicate the stockpile location on the site map.  Name of DHEC representative authorizing soil removal:		Х	
E. Was a petroleum sheen or free product detected on any excavation or boring waters?  If yes, indicate location and thickness.		Х	

### X. SAMPLE INFORMATION

A. SCDHEC Lab Certification Number 84009

B.

Sample #	Location	Sample Type (Soil/Water)	Soil Type (Sand/Clay)	Depth*	Date/Time of Collection	Collected by	OVA#
1204 Cardinal	Excav at fill end	Soil	Sandy	6'	6/18/13 1515 hrs	P. Shaw	
8							
9							
10				4			
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							

<sup>\* =</sup> Depth Below the Surrounding Land Surface

### XI. SAMPLING METHODOLOGY

Provide a detailed description of the methods used to collect <u>and</u> store the samples. Also include the preservative used for each sample. Please use the space provided below.

Sampling was performed in accordance with SC DHEC R.61-92 Part 280
and SC DHEC Assessment Guidelines. Sample containers were prepared by th
testing laboratory. The grab method was utilized to fill the sample
containers leaving as little head space as possible and immediately
capped. Soil samples were extracted from area below tank. The
samples were marked, logged, and immediately placed in a sample cooler
packed with ice to maintain an approximate temperature of 4 degrees
Centigrade. Tools were thoroughly cleaned and decontaminated with
the seven step decon process after each use. The samples remained in
custody of SBG-EEG, Inc. until they were transferred to Test America
Incorporated for analysis as documented in the Chain of Custody Record.
·


### XII. RECEPTORS


		Yes	No
A.	Are there any lakes, ponds, streams, or wetlands located within 1000 feet of the UST system? *Stormwater drainage	*X cana	
	If yes, indicate type of receptor, distance, and direction on site map.		
B.	Are there any public, private, or irrigation water supply wells within 1000 feet of the UST system?		Х
	If yes, indicate type of well, distance, and direction on site map.	$\equiv 1$	
C.	Are there any underground structures (e.g., basements) Located within 100 feet of the UST system?		Х
	If yes, indicate type of structure, distance, and direction on site map.		
D.	Are there any underground utilities (e.g., telephone, electricity, gas, water, sewer, storm drain) located within 100 feet of the UST system that could potentially come in contact with the contamination?  *Sewer, water, electric cable, fiber optic & ge		ma l
	If yes, indicate the type of utility, distance, and direction on the site map.	other	шат
E.	Has contaminated soil been identified at a depth less than 3 feet below land surface in an area that is not capped by asphalt or concrete?		Х
	If yes, indicate the area of contaminated soil on the site map.		


### XIII. SITE MAP

You must supply a <u>scaled</u> site map. It should include all buildings, road names, utilities, tank and dispenser island locations, labeled sample locations, extent of excavation, and any other pertinent information.

(Attach Site Map Here)

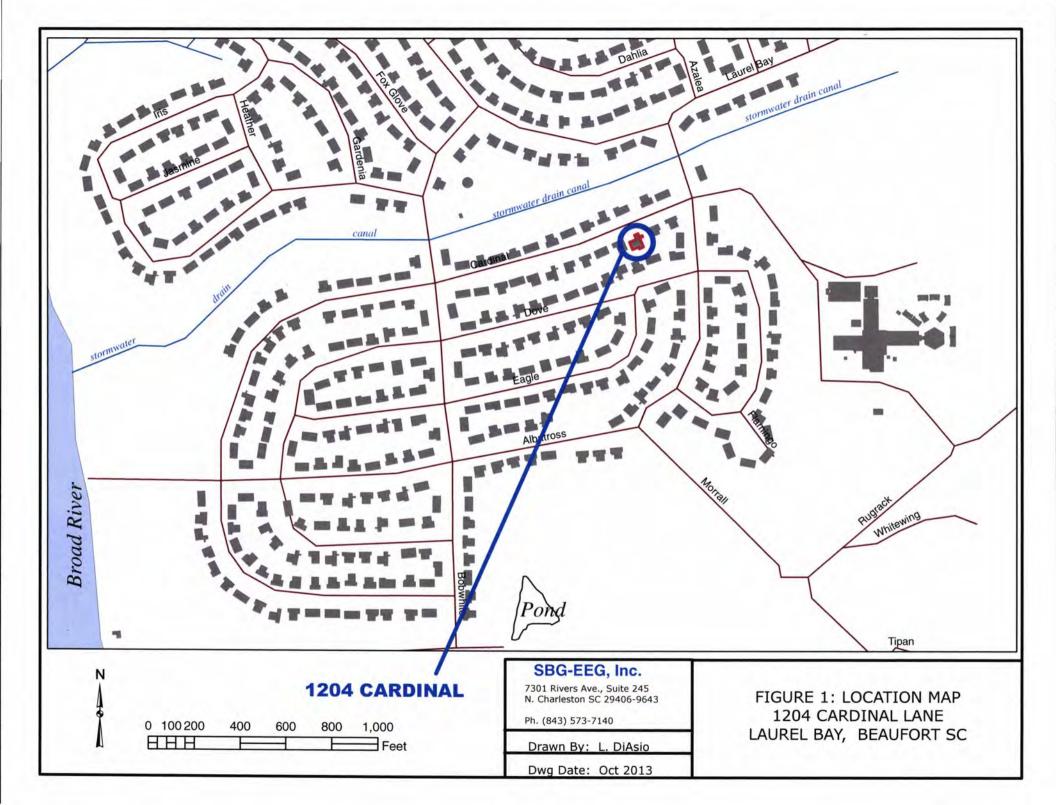

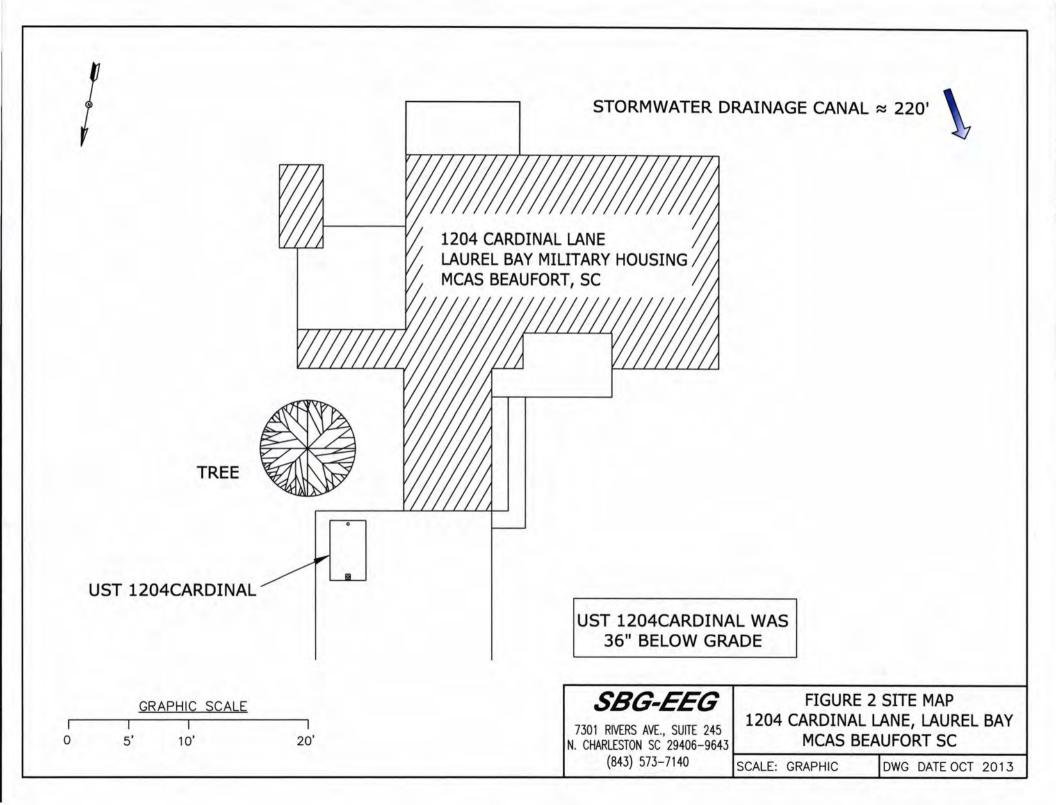

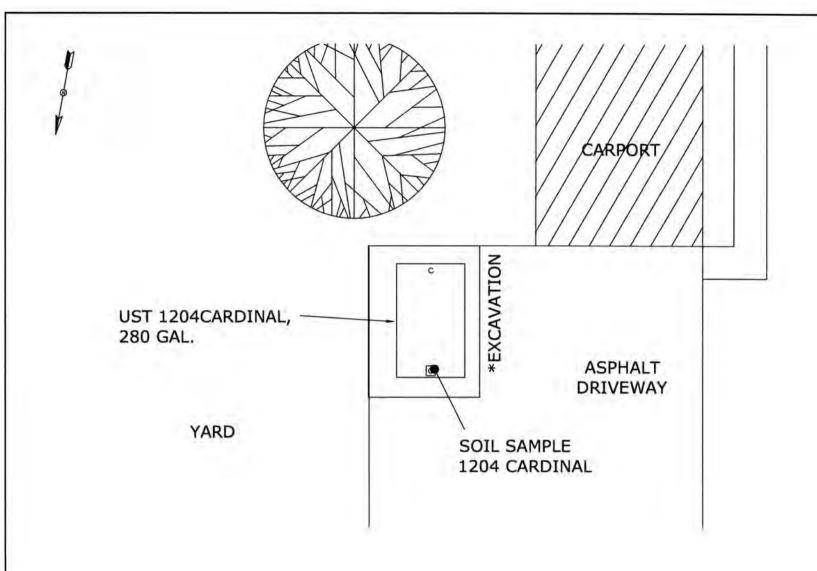

GRAPHIC SCALE

O 5'

\*A PORTION OF THE ASPHALT DRIVEWAY WAS REMOVED TO FACILITATE TANK EXTRACTION.

### SBG-EEG

7301 RIVERS AVE., SUITE 245 N. CHARLESTON SC 29406-9643 (843) 573-7140 FIGURE 3 UST SAMPLE LOCATIONS 1204 CARDINAL LANE, LAUREL BAY MCAS BEAUFORT SC

SCALE: GRAPHIC

DWG DATE OCT 2013



Picture 1: Location of UST 1204Cardinal.



Picture 2: UST 1204Cardinal excavation.

### XIV. SUMMARY OF ANALYSIS RESULTS

Enter the soil analytical data for each soil boring for all COC in the table below and on the following page.

CoC UST	1204Cardinal				
Benzene	ND	-			
Toluene	ND				
Ethylbenzene	ND				
Xylenes	ND				
Naphthalene	ND				
Benzo (a) anthracene	0.0990 mg/kg				
Benzo (b) fluoranthene	0.104 mg/kg				
Benzo (k) fluoranthene	0.0519 mg/kg				
Chrysene	0.0744 mg/kg				
Dibenz (a, h) anthracene	ND				
TPH (EPA 3550)					
CoC					-
Benzene					
Toluene					
Ethylbenzene					
Xylenes					
Naphthalene					
Benzo (a) anthracene					
Benzo (b) fluoranthene					
Benzo (k) fluoranthene					
Chrysene					
Dibenz (a, h) anthracene					
TPH (EPA 3550)					

SUMMARY OF ANALYSIS RESULTS (cont'd)

Enter the ground water analytical data for each sample for all CoC in the table below. If free product is present, indicate the measured thickness to the nearest 0.01 feet.

CoC	RBSL (µg/l)	W-1	W-2	W -3	W -4
Free Product Thickness	None				
Benzene	5				
Toluene	1,000				
Ethylbenzene	700				
Xylenes	10,000				
Total BTEX	N/A				
МТВЕ	40				7
Naphthalene	25				
Benzo (a) anthracene	10				
Benzo (b) flouranthene	10				
Benzo (k) flouranthene	10				
Chrysene	10				
Dibenz (a, h) anthracene	10				
EDB	.05				
1,2-DCA	5				
Lead	Site specific				

### XV. ANALYTICAL RESULTS

You must submit the laboratory report and chain-of-custody form for the samples. These samples must be analyzed by a South Carolina certified laboratory.

(Attach Certified Analytical Results and Chain-of-Custody Here)
(Please see Form #4)



# **TestAmerica**

THE LEADER IN ENVIRONMENTAL TESTING

### **ANALYTICAL REPORT**

TestAmerica Laboratories, Inc.

TestAmerica Nashville 2960 Foster Creighton Drive Nashville, TN 37204 Tel: (615)726-0177

TestAmerica Job ID: 490-29694-1

Client Project/Site: Laurel Bay Housing

#### For

Small Business Group Inc. 10179 Highway 78 Ladson, South Carolina 29456

Attn: Tom McElwee

Kuth Hay

Authorized for release by: 7/10/2013 2:26:33 PM

Ken Hayes, Project Manager I ken.hayes@testamericainc.com

The test results in this report meet all 2003 NELAC and 2009 TNI requirements for accredited parameters, exceptions are noted in this report. This report may not be reproduced except in full, and with written approval from the laboratory. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

This report has been electronically signed and authorized by the signatory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

Results relate only to the items tested and the sample(s) as received by the laboratory.

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

**Table of Contents** 

	_	_	 -			_		_	_	-	_	_	_	_	_	_	_						
Cover Page			 																				1
Table of Contents																							2
Sample Summary							 												 				3
Case Narrative																							
Definitions																							
Client Sample Results .																							6
QC Sample Results																							
QC Association																				 			13
Chronicle																							
Method Summary																							15
Certification Summary .																							16
Chain of Custody																							
Receipt Checklists																							19

### **Sample Summary**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

2

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
490-29694-1	916 Barracuda	Solid	06/17/13 14:00	06/26/13 08:15
490-29694-2	1204 Cardinal	Solid	06/18/13 15:15	06/26/13 08:15

3

5

6

7

8

9

10

Щ

### **Case Narrative**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Job ID: 490-29694-1

Laboratory: TestAmerica Nashville

Narrative

Job Narrative 490-29694-1

#### Comments

No additional comments.

#### Receipt

The samples were received on 6/26/2013 8:15 AM; the samples arrived in good condition, properly preserved and, where required, on ice. The temperature of the cooler at receipt was 4.8° C.

#### GC/MS VOA

Method(s) 8260B: Internal standard responses were outside of acceptance limits for the following sample(s): (490-29836-4 MS), (490-29836-4 MSD), SS 20 - 12 (490-29836-4). The sample(s) shows evidence of matrix interference.

Method(s) 8260B: Surrogate recovery for the following sample(s) was outside control limits: SS 20 - 12 (490-29836-4) and (490-29836-4) MS& MSD). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

No other analytical or quality issues were noted.

#### GC/MS Semi VOA

Method(s) 8270D: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for batch 89634 were outside control limits. The associated laboratory control sample (LCS) recovery met acceptance criteria.

No other analytical or quality issues were noted.

#### **Organic Prep**

No analytical or quality issues were noted.

#### **VOA Prep**

No analytical or quality issues were noted.

### **Definitions/Glossary**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

### 2

### Qualifiers

### GC/MS VOA

Qualifier	Qualifier Description								
X	Surrogate is outside control limits								

Reporting Limit or Requested Limit (Radiochemistry)

Toxicity Equivalent Factor (Dioxin)
Toxicity Equivalent Quotient (Dioxin)

Relative Percent Difference, a measure of the relative difference between two points

### GC/MS Semi VOA

Qualifier	Qualifier Description
F	MS or MSD exceeds the control limits
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.

### Glossary

RL

**RPD** 

TEF

TEQ

Abbreviation	These commonly used abbreviations may or may not be present in this report.
п	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CNF	Contains no Free Liquid
DER	Duplicate error ratio (normalized absolute difference)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision level concentration
MDA	Minimum detectable activity
EDL	Estimated Detection Limit
MDC	Minimum detectable concentration
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
NC	Not Calculated
ND	Not detected at the reporting limit (or MDL or EDL if shown)
PQL	Practical Quantitation Limit
QC	Quality Control
RER	Relative error ratio

TestAmerica Nashville

### **Client Sample Results**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

2

Client Sample ID: 916 Barracuda

Date Collected: 06/17/13 14:00 Date Received: 06/26/13 08:15

Analyte

Percent Solids

Lab Sample ID: 490-29694-1

Matrix: Solid

Percent Solids: 76.2

Method: 8260B - Volatile Orga Analyte	TOTAL TOTAL STREET, ST	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	ND		0.00243	0.000815	mg/Kg	a	06/27/13 10:49	06/28/13 20:55	1
Ethylbenzene	ND		0.00243	0.000815	mg/Kg	TE.	06/27/13 10:49	06/28/13 20:55	1
Naphthalene	ND		0.00608	0.00207	mg/Kg	n	06/27/13 10:49	06/28/13 20:55	1
Toluene	ND		0.00243	0.000900	mg/Kg	Ω	06/27/13 10:49	06/28/13 20:55	1
Xylenes, Total	ND		0.00608	0.000815	mg/Kg	Ø	06/27/13 10:49	06/28/13 20:55	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	98		70 - 130				06/27/13 10:49	06/28/13 20:55	1
4-Bromofluorobenzene (Surr)	112		70 - 130				06/27/13 10:49	06/28/13 20:55	1
Dibromofluoromethane (Surr)	98		70 - 130				06/27/13 10:49	06/28/13 20:55	1
Toluene-d8 (Surr)	101		70 - 130				06/27/13 10:49	06/28/13 20:55	1
Method: 8270D - Semivolatile	Organic Compou	nds (GC/MS)							
Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Acenaphthene	ND		0.0872	0.0130	mg/Kg	Ø	06/28/13 09:53	06/29/13 20:53	1
Acenaphthylene	ND		0.0872	0.0117	mg/Kg	n	06/28/13 09:53	06/29/13 20:53	1
Anthracene	ND		0.0872	0.0117	mg/Kg	22	06/28/13 09:53	06/29/13 20:53	1
Benzo[a]anthracene	1.34		0.0872	0.0195	mg/Kg	n	06/28/13 09:53	06/29/13 20:53	1
Benzo[a]pyrene	0.712		0.0872	0.0156	mg/Kg	II	06/28/13 09:53	06/29/13 20:53	1
Benzo[b]fluoranthene	0.903		0.0872	0.0156	mg/Kg	a	06/28/13 09:53	06/29/13 20:53	1
Benzo[g,h,i]perylene	0.313		0.0872	0.0117	mg/Kg	22	06/28/13 09:53	06/29/13 20:53	1
Benzo[k]fluoranthene	0.821		0.0872	0.0182	mg/Kg	22	06/28/13 09:53	06/29/13 20:53	1
1-Methylnaphthalene	ND		0.0872	0.0182	mg/Kg	22	06/28/13 09:53	06/29/13 20:53	1
Pyrene	1.63		0.0872	0.0156	mg/Kg	TI.	06/28/13 09:53	06/29/13 20:53	1
Phenanthrene	ND		0.0872	0.0117	mg/Kg	22	06/28/13 09:53	06/29/13 20:53	1
Chrysene	1.98		0.0872	0.0117	mg/Kg	32	06/28/13 09:53	06/29/13 20:53	1
Dibenz(a,h)anthracene	0.137		0.0872	0.00911	mg/Kg	¤	06/28/13 09:53	06/29/13 20:53	1
Fluoranthene	1.50		0.0872	0.0117	mg/Kg	12	06/28/13 09:53	06/29/13 20:53	1
Fluorene	ND		0.0872	0.0156	mg/Kg	H	06/28/13 09:53	06/29/13 20:53	1
Indeno[1,2,3-cd]pyrene	0.301		0.0872	0.0130	mg/Kg	n	06/28/13 09:53	06/29/13 20:53	1
Naphthalene	ND		0.0872	0.0117	mg/Kg	TI.	06/28/13 09:53	06/29/13 20:53	- 1
2-Methylnaphthalene	ND		0.0872	0.0208	mg/Kg	n	06/28/13 09:53	06/29/13 20:53	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
2-Fluorobiphenyl (Surr)	34		29 - 120				06/28/13 09:53	06/29/13 20:53	1
Terphenyl-d14 (Surr)	40		13 - 120				06/28/13 09:53	06/29/13 20:53	1
Nitrobenzene-d5 (Surr)	36		27 - 120				06/28/13 09:53	06/29/13 20:53	1
General Chemistry									

Analyzed

06/27/13 13:14

Dil Fac

RL

0.10

RL Unit

0.10 %

Prepared

Result Qualifier

76

# **Client Sample Results**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Client Sample ID: 1204 Cardinal

Date Collected: 06/18/13 15:15 Date Received: 06/26/13 08:15

**Percent Solids** 

Lab Sample ID: 490-29694-2

	Matrix: Solid	
Percent	Solids: 93.1	

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	ND		0.00224	0.000751	mg/Kg	n	06/27/13 10:49	06/28/13 21:26	1
Ethylbenzene	ND		0.00224	0.000751	mg/Kg	302	06/27/13 10:49	06/28/13 21:26	1
Naphthalene	ND		0.00561	0.00191	mg/Kg	322	06/27/13 10:49	06/28/13 21:26	1
Toluene	ND		0.00224	0.000830	mg/Kg	D	06/27/13 10:49	06/28/13 21:26	1
Xylenes, Total	ND		0.00561	0.000751	mg/Kg	n	06/27/13 10:49	06/28/13 21:26	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	100		70 - 130				06/27/13 10:49	06/28/13 21:26	1
4-Bromofluorobenzene (Surr)	105		70 - 130				06/27/13 10:49	06/28/13 21:26	1
Dibromofluoromethane (Surr)	99		70 - 130				06/27/13 10:49	06/28/13 21:26	1
Toluene-d8 (Surr)	101		70 - 130				06/27/13 10:49	06/28/13 21:26	1
Method: 8270D - Semivolatile	Organic Compou	nds (GC/MS	3)						
Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Acenaphthene	ND		0.0717	0.0107	mg/Kg	23	06/28/13 09:53	06/29/13 22:05	1
Acenaphthylene	ND		0.0717	0.00963	mg/Kg	12	06/28/13 09:53	06/29/13 22:05	1
Anthracene	ND		0.0717	0.00963	mg/Kg	121	06/28/13 09:53	06/29/13 22:05	1
Benzo[a]anthracene	0.0990		0.0717	0.0161	mg/Kg	n	06/28/13 09:53	06/29/13 22:05	1
Benzo[a]pyrene	0.0388	J	0.0717	0.0128	mg/Kg	E	06/28/13 09:53	06/29/13 22:05	1
Benzo[b]fluoranthene	0.104		0.0717	0.0128	mg/Kg	n	06/28/13 09:53	06/29/13 22:05	1
Benzo[g,h,i]perylene	0.0705	J	0.0717	0.00963	mg/Kg	13	06/28/13 09:53	06/29/13 22:05	1
Benzo[k]fluoranthene	0.0519	J	0.0717	0.0150	mg/Kg	122	06/28/13 09:53	06/29/13 22:05	1
1-Methylnaphthalene	ND		0.0717	0.0150	mg/Kg	CF.	06/28/13 09:53	06/29/13 22:05	1
Pyrene	0.110		0.0717	0.0128	mg/Kg	100	06/28/13 09:53	06/29/13 22:05	1
Phenanthrene	ND		0.0717	0.00963	mg/Kg	a	06/28/13 09:53	06/29/13 22:05	1
Chrysene	0.0744		0.0717	0.00963	mg/Kg	101	06/28/13 09:53	06/29/13 22:05	1
Dibenz(a,h)anthracene	ND		0.0717	0.00749	mg/Kg	122	06/28/13 09:53	06/29/13 22:05	1
Fluoranthene	0.0982		0.0717	0.00963	mg/Kg	Ø	06/28/13 09:53	06/29/13 22:05	1
Fluorene	ND		0.0717	0.0128	mg/Kg	32	06/28/13 09:53	06/29/13 22:05	1
Indeno[1,2,3-cd]pyrene	0.0769		0.0717	0.0107	mg/Kg	13	06/28/13 09:53	06/29/13 22:05	- 1
Naphthalene	ND		0.0717	0.00963	mg/Kg	17	06/28/13 09:53	06/29/13 22:05	1
2-Methylnaphthalene	ND		0.0717	0.0171	mg/Kg	13	06/28/13 09:53	06/29/13 22:05	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
2-Fluorobiphenyl (Surr)	46		29 - 120				06/28/13 09:53	06/29/13 22:05	1
Terphenyl-d14 (Surr)	56		13 - 120				06/28/13 09:53	06/29/13 22:05	1
Nitrobenzene-d5 (Surr)	41		27 - 120				06/28/13 09:53	06/29/13 22:05	1
General Chemistry									
Analyte	Result	Qualifier	RL	RL	Unit	D	Prepared	Analyzed	Dil Fac

06/27/13 13:14

0.10

0.10 %

93

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

# Method: 8260B - Volatile Organic Compounds (GC/MS)

Lab Sample ID: MB 490-89644/6

Matrix: Solid

Analysis Batch: 89644

Client Sample ID: Method Blank

Prep Type: Total/NA

c	
1	
1	-
1	

	MB	MB							
Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	ND		0.00200	0.000670	mg/Kg			06/28/13 13:18	1
Ethylbenzene	ND		0.00200	0.000670	mg/Kg			06/28/13 13:18	1
Naphthalene	ND		0.00500	0.00170	mg/Kg			06/28/13 13:18	1
Toluene	ND		0.00200	0.000740	mg/Kg			06/28/13 13:18	1
Xylenes, Total	ND		0.00500	0.000670	mg/Kg			06/28/13 13:18	1

MB MB Dil Fac %Recovery Qualifier Limits Prepared Analyzed Surrogate 1,2-Dichloroethane-d4 (Surr) 93 70 - 130 06/28/13 13:18 4-Bromofluorobenzene (Surr) 101 70 - 130 06/28/13 13:18 Dibromofluoromethane (Surr) 99 70 - 130 06/28/13 13:18 100 70 - 130 06/28/13 13:18 Toluene-d8 (Surr)

> Client Sample ID: Lab Control Sample Prep Type: Total/NA

Lab Sample ID: LCS 490-89644/3 Matrix: Solid

Analysis Batch: 89644

	Spike	LCS	LCS				%Rec.
Analyte	Added	Result	Qualifier	Unit	D	%Rec	Limits
Benzene	0.0500	0.05133		mg/Kg		103	75 - 127
Ethylbenzene	0.0500	0.05285		mg/Kg		106	80 - 134
Naphthalene	0.0500	0.05886		mg/Kg		118	69 - 150
Toluene	0.0500	0.05095		mg/Kg		102	80 - 132
Xylenes, Total	0.150	0.1578		mg/Kg		105	80 - 137

70 - 130

LCS LCS Limits %Recovery Qualifier 1,2-Dichloroethane-d4 (Surr) 100 70 - 130 99 70 - 130 4-Bromofluorobenzene (Surr) 70 - 130 Dibromofluoromethane (Surr) 102

100

Lab Sample ID: LCSD 490-89644/4

Matrix: Solid

Toluene-d8 (Surr)

Surrogate

Analysis Batch: 89644

Client San	ple ID:	Lab	Contro	Sample	Dup
			Prep T	vpe: Total	/NA

	Spike	LCSD	LCSD				%Rec.		RPD
Analyte	Added	Result	Qualifier	Unit	D	%Rec	Limits	RPD	Limit
Benzene	0.0500	0.05240		mg/Kg		105	75 - 127	2	50
Ethylbenzene	0.0500	0.05391		mg/Kg		108	80 - 134	2	50
Naphthalene	0.0500	0.05746		mg/Kg		115	69 - 150	2	50
Toluene	0.0500	0.05201		mg/Kg		104	80 - 132	2	50
Xylenes, Total	0.150	0.1615		mg/Kg		108	80 - 137	2	50

	LCSD	LCSD	
Surrogate	%Recovery	Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	98		70 - 130
4-Bromofluorobenzene (Surr)	99		70 - 130
Dibromofluoromethane (Surr)	101		70 - 130
Toluene-d8 (Surr)	100		70 - 130

TestAmerica Nashville

Page 8 of 19

7/10/2013

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Method: 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: 490-29836-A-4-D MS

Matrix: Solid

Analysis Batch: 89644

Client Sample ID: Matrix Spike Prep Type: Total/NA

Prep Batch: 89721

	Sample	Sample	Spike	MS	MS				%Rec.	
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits	
Benzene	0.00242		0.0588	0.06905		mg/Kg	32	113	31 - 143	
Ethylbenzene	0.00204	J	0.0588	0.06627		mg/Kg	n	109	23 - 161	
Naphthalene	0.00283	J	0.0588	0.02836		mg/Kg	22	43	10 - 176	
Toluene	0.00677		0.0588	0.08413		mg/Kg	n	132	30 - 155	
Xylenes, Total	0.00740		0.176	0.1922		mg/Kg	10	105	25 - 162	

MS MS Surrogate %Recovery Qualifier Limits 1,2-Dichloroethane-d4 (Surr) 96 70 - 130 4-Bromofluorobenzene (Surr) 157 X 70 - 130 Dibromofluoromethane (Surr) 100 70 - 130 70 - 130 Toluene-d8 (Surr) 113

Lab Sample ID: 490-29836-A-4-E MSD

Matrix: Solid

Analysis Batch: 89644

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Prep Batch: 89721

	Sample	Sample	Spike	MSD	MSD				%Rec.		RPD
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits	RPD	Limit
Benzene 0	.00242		0.0567	0.07038		mg/Kg	n	120	31 - 143	2	50
Ethylbenzene	.00204	J	0.0567	0.06581		mg/Kg	0	113	23 - 161	1	50
Naphthalene 0	.00283	J	0.0567	0.02875		mg/Kg	n	46	10 - 176	1	50
Toluene	.00677		0.0567	0.08669		mg/Kg	E	141	30 - 155	3	50
Xylenes, Total	.00740		0.170	0.1877		mg/Kg	13	106	25 - 162	2	50

MSD MSD Limits Qualifier Surrogate %Recovery 70 - 130 1,2-Dichloroethane-d4 (Surr) 97 163 70 - 130 4-Bromofluorobenzene (Surr) 102 70 - 130 Dibromofluoromethane (Surr) Toluene-d8 (Surr) 112 70 - 130

Method: 8270D - Semivolatile Organic Compounds (GC/MS)

Lab Sample ID: MB 490-89634/1-A

Matrix: Solid

Analysis Batch: 89957

Client Sample ID: Method Blank	
Prep Type: Total/NA	
Prep Batch: 89634	

MB MB Dil Fac MDL Unit Analyte Result Qualifier Prepared Analyzed 06/28/13 09:53 06/29/13 18:55 ND 0.0670 0.0100 mg/Kg Acenaphthene ND 0.0670 06/28/13 09:53 06/29/13 18:55 0.00900 mg/Kg Acenaphthylene Anthracene ND 0.0670 0.00900 mg/Kg 06/28/13 09:53 06/29/13 18:55 0.0670 06/28/13 09:53 06/29/13 18:55 Benzo[a]anthracene ND 0.0150 mg/Kg 0.0670 06/28/13 09:53 06/29/13 18:55 ND 0.0120 mg/Kg Benzo[a]pyrene 06/28/13 09:53 06/29/13 18:55 Benzo[b]fluoranthene ND 0.0670 0.0120 mg/Kg ND 0.0670 0.00900 mg/Kg 06/28/13 09:53 06/29/13 18:55 Benzo[g,h,i]perylene ND 0.0670 0.0140 mg/Kg 06/28/13 09:53 06/29/13 18:55 Benzo[k]fluoranthene 0.0670 1-Methylnaphthalene ND 0.0140 mg/Kg 06/28/13 09:53 06/29/13 18:55 ND 0.0670 0.0120 mg/Kg 06/28/13 09:53 06/29/13 18:55 Phenanthrene ND 0.0670 0.00900 mg/Kg 06/28/13 09:53 06/29/13 18:55

TestAmerica Nashville

Page 9 of 19

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

Method: 8270D - Semivolatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: MB 490-89634/1-A

Matrix: Solid

Analysis Batch: 89957

Prep Type: Total/NA

Prep Batch: 89634

	MB	MB							
Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chrysene	ND		0.0670	0.00900	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
Dibenz(a,h)anthracene	ND		0.0670	0.00700	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
Fluoranthene	ND		0.0670	0.00900	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
Fluorene	ND		0.0670	0.0120	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
Indeno[1,2,3-cd]pyrene	ND		0.0670	0.0100	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
Naphthalene	ND		0.0670	0.00900	mg/Kg		06/28/13 09:53	06/29/13 18:55	1
2-Methylnaphthalene	ND		0.0670	0.0160	mg/Kg		06/28/13 09:53	06/29/13 18:55	1

MB MB Surrogate %Recovery Qualifier Limits Dil Fac Prepared Analyzed 29 - 120 2-Fluorobiphenyl (Surr) 49 06/28/13 09:53 06/29/13 18:55 13 - 120 Terphenyl-d14 (Surr) 66 06/28/13 09:53 06/29/13 18:55 27 - 120 Nitrobenzene-d5 (Surr) 43 06/28/13 09:53 06/29/13 18:55

Lab Sample ID: LCS 490-89634/2-A

Matrix: Solid

Analysis Batch: 89957

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 89634

rinaryoro Batom occor							1 1 CP D
	Spike	LCS	LCS				%Rec.
Analyte	Added	Result	Qualifier	Unit	D	%Rec	Limits
Acenaphthylene	1.67	1.271		mg/Kg		76	38 - 120
Anthracene	1.67	1.310		mg/Kg		79	46 - 124
Benzo[a]anthracene	1.67	1.361		mg/Kg		82	45 - 120
Benzo[a]pyrene	1.67	1.371		mg/Kg		82	45 - 120
Benzo[b]fluoranthene	1.67	1.457		mg/Kg		87	42 - 120
Benzo[g,h,i]perylene	1.67	1.606		mg/Kg		96	38 - 120
Benzo[k]fluoranthene	1.67	1.223		mg/Kg		73	42 - 120
1-Methylnaphthalene	1.67	1.127		mg/Kg		68	32 - 120
Pyrene	1.67	1.285		mg/Kg		77	43 - 120
Phenanthrene	1.67	1.253		mg/Kg		75	45 - 120
Chrysene	1.67	1.332		mg/Kg		80	43 - 120
Dibenz(a,h)anthracene	1.67	1.637		mg/Kg		98	32 - 128
Fluoranthene	1.67	1.368		mg/Kg		82	46 - 120
Fluorene	1.67	1.246		mg/Kg		75	42 - 120
Indeno[1,2,3-cd]pyrene	1.67	1.561		mg/Kg		94	41 - 121
Naphthalene	1.67	1.074		mg/Kg		64	32 - 120
2-Methylnaphthalene	1.67	1.104		mg/Kg		66	28 - 120

Surrogate	LCS	LCS	
	%Recovery	Qualifier	Limits
2-Fluorobiphenyl (Surr)	57		29 - 120
Terphenyl-d14 (Surr)	68		13 - 120
Nitrobenzene-d5 (Surr)	48		27 - 120

Lab Sample ID: 490-29694-1 MS

Matrix: Solid

Analysis Batch: 89957

Client Sample ID: 916 Barracuda

Prep Type: Total/NA Prep Batch: 89634

	Sample	Sample	Spike	MS	MS				%Rec.
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits
Acenaphthylene	ND		2.14	1.357		mg/Kg	n	63	25 - 120
Anthracene	ND		2.14	1.360		mg/Kg	32	64	28 - 125

TestAmerica Nashville

Page 10 of 19

7/10/2013

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Method: 8270D - Semivolatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: 490-29694-1 MS

Matrix: Solid

Analysis Batch: 89957

Client Sample ID: 916 Barracuda Prep Type: Total/NA

Prep Batch: 89634

	Sample	Sample	Spike	MS	MS				%Rec.
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits
Benzo[a]anthracene	1.34		2.14	1.626	F	mg/Kg	D	14	23 - 120
Benzo[a]pyrene	0.712		2.14	1.593		mg/Kg	O	41	15 - 128
Benzo[b]fluoranthene	0.903		2.14	1.977		mg/Kg	a	50	12 - 133
Benzo[g,h,i]perylene	0.313		2.14	1.766		mg/Kg	13	68	22 - 120
Benzo[k]fluoranthene	0.821		2.14	1.418		mg/Kg	111	28	28 - 120
1-Methylnaphthalene	ND		2.14	1.223		mg/Kg	20	57	10 - 120
Pyrene	1.63		2.14	1.533	F	mg/Kg	D	-5	20 - 123
Phenanthrene	ND		2.14	1.322		mg/Kg	10	62	21 - 122
Chrysene	1.98		2.14	1.692	F	mg/Kg	111	-13	20 - 120
Dibenz(a,h)anthracene	0.137		2.14	1.596		mg/Kg	n	68	12 - 128
Fluoranthene	1.50		2.14	1.588	F	mg/Kg	C	4	10 - 143
Fluorene	ND		2.14	1.354		mg/Kg	O	63	20 - 120
Indeno[1,2,3-cd]pyrene	0.301		2.14	1.649		mg/Kg	11	63	22 - 121
Naphthalene	ND		2.14	1.155		mg/Kg	n	54	10 - 120
2-Methylnaphthalene	ND		2.14	1.209		mg/Kg	D	57	13 - 120

Surrogate	%Recovery 0	Qualifier	Limits
2-Fluorobiphenyl (Surr)	46		29 - 120
Terphenyl-d14 (Surr)	50		13 - 120
Nitrobenzene-d5 (Surr)	42		27 - 120

Lab Sample ID: 490-29694-1 MSD

Matrix: Solid

Analysis Batch: 89957

liont	Sample	ID: 016	Rarracuda	

Prep Type: Total/NA

Prep Batch: 89634

Allalysis Datell. 00001									riep	Datell.	03034
	Sample	Sample	Spike	MSD	MSD				%Rec.		RPD
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits	RPD	Limit
Acenaphthylene	ND		2.12	1.318		mg/Kg	E	62	25 - 120	3	50
Anthracene	ND		2.12	1.215		mg/Kg	E	57	28 - 125	11	49
Benzo[a]anthracene	1.34		2.12	1.234	F	mg/Kg	T.	-5	23 - 120	27	50
Benzo[a]pyrene	0.712		2.12	1.177		mg/Kg	Œ	22	15 - 128	30	50
Benzo[b]fluoranthene	0.903		2.12	1.321		mg/Kg	D	20	12 - 133	40	50
Benzo[g,h,i]perylene	0.313		2.12	1.396		mg/Kg	-02	51	22 - 120	23	50
Benzo[k]fluoranthene	0.821		2.12	1.115	F	mg/Kg	125	14	28 - 120	24	45
1-Methylnaphthalene	ND		2.12	1.153		mg/Kg	12	54	10 - 120	6	50
Pyrene	1.63		2.12	1.193	F	mg/Kg	33	-21	20 - 123	25	50
Phenanthrene	ND		2.12	1.197		mg/Kg	n	57	21 - 122	10	50
Chrysene	1.98		2.12	1.220	F	mg/Kg	D	-36	20 - 120	32	49
Dibenz(a,h)anthracene	0.137		2.12	1.306		mg/Kg	Ħ	55	12 - 128	20	50
Fluoranthene	1.50		2.12	1.282	F	mg/Kg	12	-10	10 - 143	21	50
Fluorene	ND		2.12	1.242		mg/Kg	22	59	20 - 120	9	50
Indeno[1,2,3-cd]pyrene	0.301		2.12	1.297		mg/Kg	22	47	22 - 121	24	50
Naphthalene	ND		2.12	1.109		mg/Kg	52	52	10 - 120	4	50
2-Methylnaphthalene	ND		2.12	1.137		mg/Kg	22	54	13 - 120	6	50

Surrogate	%Recovery	Qualifier	Limits
2-Fluorobiphenyl (Surr)	42		29 - 120
Terphenyl-d14 (Surr)	43		13 - 120

TestAmerica Nashville

Page 11 of 19

7/10/2013

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Method: 8270D - Semivolatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: 490-29694-1 MSD Matrix: Solid

Analysis Batch: 89957

Nitrobenzene-d5 (Surr)

Surrogate

Client Sample ID: 916 Barracuda Prep Type: Total/NA

Prep Batch: 89634

MSD MSD

Limits %Recovery Qualifier 27 - 120 42

Client Sample ID: Duplicate Prep Type: Total/NA

Method: Moisture - Percent Moisture

Lab Sample ID: 490-29682-D-21 DU

Matrix: Solid

Percent Solids

Analysis Batch: 89426

Analyte

Sample Sample Result Qualifier

DU DU Result Qualifier 82

Unit %

D

RPD

RPD

Limit

20

# **QC Association Summary**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

2

#### GC/MS VOA

Pre	n B	atc	h:	89	359	1
1 10	_	att		S	000	,

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
490-29694-1	916 Barracuda	Total/NA	Solid	5035	
490-29694-2	1204 Cardinal	Total/NA	Solid	5035	

#### Analysis Batch: 89644

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
490-29694-1	916 Barracuda	Total/NA	Solid	8260B	89359
490-29694-2	1204 Cardinal	Total/NA	Solid	8260B	89359
490-29836-A-4-D MS	Matrix Spike	Total/NA	Solid	8260B	89721
490-29836-A-4-E MSD	Matrix Spike Duplicate	Total/NA	Solid	8260B	89721
LCS 490-89644/3	Lab Control Sample	Total/NA	Solid	8260B	
LCSD 490-89644/4	Lab Control Sample Dup	Total/NA	Solid	8260B	
MB 490-89644/6	Method Blank	Total/NA	Solid	8260B	

#### Prep Batch: 89721

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
490-29836-A-4-D MS	Matrix Spike	Total/NA	Solid	5035	
490-29836-A-4-E MSD	Matrix Spike Duplicate	Total/NA	Solid	5035	

#### GC/MS Semi VOA

#### Prep Batch: 89634

The second second					
Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
490-29694-1	916 Barracuda	Total/NA	Solid	3550C	
490-29694-1 MS	916 Barracuda	Total/NA	Solid	3550C	
490-29694-1 MSD	916 Barracuda	Total/NA	Solid	3550C	
490-29694-2	1204 Cardinal	Total/NA	Solid	3550C	
LCS 490-89634/2-A	Lab Control Sample	Total/NA	Solid	3550C	
MB 490-89634/1-A	Method Blank	Total/NA	Solid	3550C	

#### Analysis Batch: 89957

Client Sample ID	Prep Type	Matrix	Method	Prep Batch
916 Barracuda	Total/NA	Solid	8270D	89634
916 Barracuda	Total/NA	Solid	8270D	89634
916 Barracuda	Total/NA	Solid	8270D	89634
1204 Cardinal	Total/NA	Solid	8270D	89634
Lab Control Sample	Total/NA	Solid	8270D	89634
Method Blank	Total/NA	Solid	8270D	89634
	916 Barracuda 916 Barracuda 916 Barracuda 1204 Cardinal Lab Control Sample	916 Barracuda         Total/NA           916 Barracuda         Total/NA           916 Barracuda         Total/NA           1204 Cardinal         Total/NA           Lab Control Sample         Total/NA	916 Barracuda Total/NA Solid 916 Barracuda Total/NA Solid 916 Barracuda Total/NA Solid 916 Cardinal Total/NA Solid Lab Control Sample Total/NA Solid	916 Barracuda         Total/NA         Solid         8270D           916 Barracuda         Total/NA         Solid         8270D           916 Barracuda         Total/NA         Solid         8270D           1204 Cardinal         Total/NA         Solid         8270D           Lab Control Sample         Total/NA         Solid         8270D

#### **General Chemistry**

#### Analysis Batch: 89426

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
490-29682-D-21 DU	Duplicate	Total/NA	Solid	Moisture	
490-29694-1	916 Barracuda	Total/NA	Solid	Moisture	
490-29694-2	1204 Cardinal	Total/NA	Solid	Moisture	

TestAmerica Nashville

#### **Lab Chronicle**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

Client Sample ID: 916 Barracuda

Client Sample ID: 1204 Cardinal

Date Collected: 06/18/13 15:15

Date Received: 06/26/13 08:15

Date Collected: 06/17/13 14:00 Date Received: 06/26/13 08:15

Lab Sample ID: 490-29694-1

Matrix: Solid

Percent Solids: 76.2

	Batch	Batch		Dilution	Batch	Prepared		
Prep Type	Туре	Method	Run	Factor	Number	or Analyzed	Analyst	Lab
Total/NA	Prep	5035			89359	06/27/13 10:49	MLN	TAL NSH
Total/NA	Analysis	8260B		1	89644	06/28/13 20:55	KKK	TAL NSH
Total/NA	Prep	3550C			89634	06/28/13 09:53	JLP	TAL NSH
Total/NA	Analysis	8270D		1	89957	06/29/13 20:53	KJP	TAL NSH
Total/NA	Analysis	Moisture		1	89426	06/27/13 13:14	RRS	TAL NSH

Lab Sample ID: 490-29694-2

Matrix: Solid

Percent Solids: 93.1

	Batch	Batch		Dilution	Batch	Prepared		
Prep Type	Туре	Method	Run	Factor	Number	or Analyzed	Analyst	Lab
Total/NA	Prep	5035			89359	06/27/13 10:49	MLN	TAL NSH
Total/NA	Analysis	8260B		1	89644	06/28/13 21:26	KKK	TAL NSH
Total/NA	Prep	3550C			89634	06/28/13 09:53	JLP	TAL NSH
Total/NA	Analysis	8270D		1	89957	06/29/13 22:05	KJP	TAL NSH
Total/NA	Analysis	Moisture		1	89426	06/27/13 13:14	RRS	TAL NSH

**Laboratory References:** 

TAL NSH = TestAmerica Nashville, 2960 Foster Creighton Drive, Nashville, TN 37204, TEL (615)726-0177

TestAmerica Nashville

# **Method Summary**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing

TestAmerica Job ID: 490-29694-1

2

Method Description	Protocol	Laboratory
Volatile Organic Compounds (GC/MS)	SW846	TAL NSH
Semivolatile Organic Compounds (GC/MS)	SW846	TAL NSH
Percent Moisture	EPA	TAL NSH

4

Protocol References:

Method

8260B

8270D

Moisture

EPA = US Environmental Protection Agency

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

**Laboratory References:** 

TAL NSH = TestAmerica Nashville, 2960 Foster Creighton Drive, Nashville, TN 37204, TEL (615)726-0177

M

0

9

10

12

13

# **Certification Summary**

Client: Small Business Group Inc. Project/Site: Laurel Bay Housing


TestAmerica Job ID: 490-29694-1

# Laboratory: TestAmerica Nashville

All certifications held by this laboratory are listed. Not all certifications are applicable to this report.

Authority	Program	EPA Region	Certification ID	<b>Expiration Date</b>
	ACIL		393	10-30-13
A2LA	ISO/IEC 17025		0453.07	12-31-13
Alaska (UST)	State Program	10	UST-087	07-24-13
Arizona	State Program	9	AZ0473	05-05-14
Arkansas DEQ	State Program	6	88-0737	04-25-14
California	NELAP	9	1168CA	10-31-13
Connecticut	State Program	1	PH-0220	12-31-13
Florida	NELAP	4	E87358	06-30-14
Illinois	NELAP	5	200010	12-09-13
Iowa	State Program	7	131	05-01-14
Kansas	NELAP	7	E-10229	10-31-13
Kentucky (UST)	State Program	4	19	09-15-13
Louisiana	NELAP	6	30613	06-30-14
Maryland	State Program	3	316	03-31-14
Massachusetts	State Program	1	M-TN032	06-30-14
Minnesota	NELAP	5	047-999-345	12-31-13
Mississippi	State Program	4	N/A	06-30-13 *
Montana (UST)	State Program	8	NA	01-01-15
Nevada	State Program	9	TN00032	07-31-13
New Hampshire	NELAP	1	2963	10-10-13
New Jersey	NELAP	2	TN965	06-30-14
New York	NELAP	2	11342	04-01-14
North Carolina DENR	State Program	4	387	12-31-13
North Dakota	State Program	8	R-146	06-30-13 *
Ohio VAP	State Program	5	CL0033	01-19-14
Oklahoma	State Program	6	9412	08-31-13
Oregon	NELAP	10	TN200001	04-29-14
Pennsylvania	NELAP	3	68-00585	06-30-14
Rhode Island	State Program	1	LAO00268	12-30-13
South Carolina	State Program	4	84009 (001)	02-28-14
South Carolina	State Program	4	84009 (002)	02-23-14
Tennessee	State Program	4	2008	02-23-14
Texas	NELAP	6	T104704077-09-TX	08-31-13
USDA	Federal		S-48469	11-02-13
Utah	NELAP	8	TAN	07-30-13 *
Virginia	NELAP	3	460152	06-14-14
Washington	State Program	10	C789	07-19-13
West Virginia DEP	State Program	3	219	02-28-14
Wisconsin	State Program	5	998020430	08-31-13
Wyoming (UST)	A2LA	8	453.07	12-31-13

<sup>\*</sup> Expired certification is currently pending renewal and is considered valid.

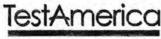

THE LEADER IN ENVIRONMENTAL TESTING Nashville, TN

### COOLER RECEIP



190-29694 Chain of Custody

	hain of Custody
1. Tracking #(last 4 digits, FedEx)	
Courier: Fed-Ex IR Gun ID: <u>14740456</u>	
2. Temperature of rep. sample or temp blank when opened: 4.8 Degrees Celsius	S
3. If Item #2 temperature is $0^{\circ}\text{C}$ or less, was the representative sample or temp blank froz	en? YES NO. NA
4. Were custody seals on outside of cooler?	ERNONA
If yes, how many and where: 2 Front /Bdc	K
5. Were the seals intact, signed, and dated correctly?	YESNONA
6. Were custody papers inside cooler?	YES NONA
I certify that I opened the cooler and answered questions 1-6 (intial)	F
7. Were custody seals on containers: YES (NO) and Intact	YESNO. NA
Were these signed and dated correctly?	YESNOA
8. Packing mat'l used? Bubblewrap Plastic bag Peanuts Vermiculite Foam Insert P	aper Other None
9. Cooling process: (ce lice-pack lice (direct contact) Dry	y ice Other None
10. Did all containers arrive in good condition (unbroken)?	YES NO NA
11. Were all container labels complete (#, date, signed, pres., etc)?	YES NO NA
12. Did all container labels and tags agree with custody papers?	VES NO NA
13a. Were VOA vials received?	FES:.NONA
b. Was there any observable headspace present in any VOA vial?	YES 10 NA-
14. Was there a Trip Blank in this cooler? YESNO A If multiple coolers, seq	uence # NA
certify that I unloaded the cooler and answered questions 7-14 (intial)	F
15a. On pres'd bottles, did pH test strips suggest preservation reached the correct pH lev	el? YESNONA
b. Did the bottle labels indicate that the correct preservatives were used	YES NO NA
16. Was residual chlorine present?	YESNONA
certify that I checked for chlorine and pH as per SOP and answered guestions 15-16 (inti	al) F
17. Were custody papers properly filled out (ink, signed, etc)?	YES NO NA
18. Did you sign the custody papers in the appropriate place?	ESNONA
19. Were correct containers used for the analysis requested?	EPNONA
20. Was sufficient amount of sample sent in each container?	ESNONA
certify that I entered this project into LIMS and answered questions 17-20 (intial)	#

# Login Sample Receipt Checklist

Client: Small Business Group Inc.

Job Number: 490-29694-1

Login Number: 29694

List Source: TestAmerica Nashville

List Number: 1

Elot Italianotti i			
Creator: Ford, Easton			
Question	Answer	Comment	
Radioactivity wasn't checked or is = background as measured by a survey meter.</td <td>True</td> <td></td> <td></td>	True		
The cooler's custody seal, if present, is intact.	True		
Sample custody seals, if present, are intact.	True		
The cooler or samples do not appear to have been compromised or tampered with.	True		
Samples were received on ice.	True		
Cooler Temperature is acceptable.	True		
Cooler Temperature is recorded.	True		
COC is present.	True		
COC is filled out in ink and legible.	True		
COC is filled out with all pertinent information.	True		
Is the Field Sampler's name present on COC?	True		
There are no discrepancies between the containers received and the COC.	True		
Samples are received within Holding Time.	True		
Sample containers have legible labels.	True		
Containers are not broken or leaking.	True		
Sample collection date/times are provided.	True		
Appropriate sample containers are used.	True		
Sample bottles are completely filled.	True		
Sample Preservation Verified.	N/A		
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True		
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	N/A		

Multiphasic samples are not present.

Residual Chlorine Checked.

Samples do not require splitting or compositing.

True True

N/A

# ATTACHMENT A



# **NON-HAZARDOUS MANIFEST**

NON-HAZARDOUS MANIFEST	1. Generator's l	JS EPA ID No.	Mai	nifest Doc	No.	2. Page 1		19 :		
3. Generator's Mailing Address: MCAS BEAUFORT LAUREL BAY HOUSING BEAUFORT, SC 29904 4. Generator's Phone 843-8'	79-0411	Generator's Site Ad	dress (If dif	ferent than n	nailing):		MNA B. State	01519 Generator's		
5. Transporter 1 Company Name 7. Transporter 2 Company Name			US EPA ID			D. Transp	ransporter's I orter's Phone ransporter's I orter's Phone	843)°	879-0	) Y00
9. Designated Facility Name and Site HICKORY HILL LANDFILL 2621 LOW COUNTRY DRIVE RIDGELAND, SC 29936	Address	10.	US EPA II	D Number		G. State F			987-464	3
11. Description of Waste Materials				12. C	ontainers Type	13. Total Quantity	14. Unit Wt./Vol.	1. N	Aisc. Commer	its
a. HEATING OIL TANK FILLED V				1	204	9.79	TON	715	077	/
b. TO WM Profile #	ile # 102655S				9					
c.  WM Profile #										
d. WM Profile #										
J. Additional Descriptions for Mater	ials Listed Above		a:25	K. Dispo	osal Location	וֹ		Level		
15. Special Handling Instructions and CST 5 + R 0 mg 13 5 4 CAR 1 Purchase Order #  16. GENERATOR'S CERTIFICATE: I hereby certify that the above-descri	NA (1/3)	868 Cobi 886 Cobi EMERG	ENCY CON	(4) (5) 91 (1) (1) (1) (1) (1) (1) (1) (1) (1) (1)	HONE NO.:		cable state la			
Printed Name / MOTH	uhal	n proper condition fo Signature		-	ording to ap	oplicable regu	alations.	Month	Day 14	Year
17. Transporter 1 Acknowledgement Printed Name	THAN	Signature	NI	06	AS	V	1	Month	Day /4	Year 13
18. Transporter 2 Acknowledgement Printed Name JAMES WALL	of Receipt of Mal	Signature	mes	Red	Lalu			Month	Day 15	Year 13
19. Certificate of Final Treatment/Distriction     I certify, on behalf of the above listed applicable laws, regulations, permits 20. Facility Owner or Operator: Certifications (Certification)	treatment facility and licenses on th	e dates listed above.		¥ 110			as managed i	in compliand	e with all	
Printed Name	cd	Signature	VO7	u	Cof	eld	llow- GENERA	Month 8	Day 15	Year 13

Pink- FACILITY USE ONLY

Gold-TRANSPORTER #1 COPY

# Appendix C Regulatory Correspondence





#### Catherine E. Heigel, Director

Promoting and protecting the health of the public and the environment

July 1, 2015

Commanding Officer
Attention: NREAO Mr. William A. Drawdy
United State Marine Corps Air Station
Post Office Box 55001
Beaufort, SC 29904-5001

RE: No Further Action

Laurel Bay Underground Storage Tank Assessment Reports for:

See attached sheet

Dear Mr. Drawdy,

The South Carolina Department of Health and Environmental Control (the Department) received the referenced Underground Storage Tanks (USTs) Assessment Reports for the addresses listed above. The regulatory authority for the investigation and cleanup of releases from these tank systems is the South Carolina Pollution Control Act (S.C. Code Ann. §48-1-10 et seq., as amended).

The Department has reviewed the referenced assessment reports and agrees there is no indication of soil or groundwater contamination on these properties, and therefore no further investigation is required at this time.

Please note that the Department's decision is based on information provided by the Marine Corps Air Station (MCAS) to date. Any information found to be contradictory to this decision may require additional action. Furthermore, the Department retains the right to request further investigation if deemed necessary.

If you have any questions, please contact me at <a href="mailto:kriegkm@dhec.sc.gov">kriegkm@dhec.sc.gov</a> or 803-898-0255.

Sincerely,

Kent Krieg

Department of Defense Corrective Action Section

Bureau of Land and Waste Management

South Carolina Department of Health and Environmental Control

Cc: Russell Berry (via email)

Craig Ehde (via email) Bryan Beck (via email)



#### Catherine E. Heigel, Director

Promoting and protecting the health of the public and the environment

**Attachment to**: Krieg to Drawdy

Subject: NFA
Dated 7/1/2015

# Laurel Bay Underground Storage Tank Assessment Reports for: (153 addresses/161 tanks)

111 BitCh   363 Aspen   364 Aspen   364 Aspen   364 Aspen   369 Aspen   369 Aspen   369 Aspen   373 Aspen   369 Aspen   373 Aspen   369 Aspen   373 Aspen   373 Aspen   373 Aspen   373 Aspen   374 Aspen   375 Aspen   376 Aspen   376 Aspen   377 Aspen   377 Aspen   378 Aspen   378 Aspen   378 Aspen   378 Aspen   379 Aspen   370	111 Direct	262 Asman
131 Banyan       366 Aspen         134 Banyan       369 Aspen         145 Laurel Bay       373 Aspen         150 Laurel Bay       381 Aspen         153 Laurel Bay       401 Elderberry         154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         225 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         3	111 Birch	363 Aspen
134 Banyan       369 Aspen         145 Laurel Bay       373 Aspen         150 Laurel Bay       381 Aspen         153 Laurel Bay       401 Elderberry         154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	•	1
145 Laurel Bay       373 Aspen         150 Laurel Bay       381 Aspen         153 Laurel Bay       401 Elderberry         154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       466 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		1
150 Laurel Bay       381 Aspen         153 Laurel Bay       401 Elderberry         154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       487 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	•	
153 Laurel Bay       401 Elderberry         154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         284 Birch Tank 2       524 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		
154 Laurel Bay       402 Elderberry         155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		1
155 Laurel Bay       404 Elderberry         200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		
200 Balsam       410 Elderberry         202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		ž
202 Balsam       420 Elderberry         203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		ž
203 Balsam       424 Elderberry         208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2		J
208 Balsam       435 Elderberry Tank 3         210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	202 Balsam	420 Elderberry
210 Balsam       452 Elderberry         211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487 Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	203 Balsam	424 Elderberry
211 Balsam       460 Elderberry         220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	208 Balsam	435 Elderberry Tank 3
220 Cypress       465 Dogwood         222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	210 Balsam	452 Elderberry
222 Cypress       477 Laurel Bay         223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	211 Balsam	460 Elderberry
223 Cypress       487Laurel Bay         252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	220 Cypress	465 Dogwood
252 Beech Tank 2       513 Laurel Bay         271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	222 Cypress	477 Laurel Bay
271 Beech Tank 1       519 Laurel Bay         271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	223 Cypress	487Laurel Bay
271 Beech Tank 2       524 Laurel Bay         284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	252 Beech Tank 2	513 Laurel Bay
284 Birch Tank 1       535 Laurel Bay         284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	271 Beech Tank 1	519 Laurel Bay
284 Birch Tank 2       553 Dahlia         308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	271 Beech Tank 2	524 Laurel Bay
308 Ash       590 Aster         311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	284 Birch Tank 1	535 Laurel Bay
311 Ash       591 Aster         312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	284 Birch Tank 2	553 Dahlia
312 Ash       610 Dahlia         317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	308 Ash	590 Aster
317 Ash       612 Dahlia         318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	311 Ash	591 Aster
318 Ash       628 Dahlia         337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	312 Ash	610 Dahlia
337 Ash       636 Dahlia         351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	317 Ash	612 Dahlia
351 Ash Tank 1       637 Dahlia Tank 1         351 Ash Tank 2       637 Dahlia Tank 2	318 Ash	628 Dahlia
351 Ash Tank 2 637 Dahlia Tank 2	337 Ash	636 Dahlia
	351 Ash Tank 1	637 Dahlia Tank 1
	351 Ash Tank 2	637 Dahlia Tank 2
355 Ash Tank 2 642 Dahlia Tank 1		
360 Aspen 642 Dahlia Tank 2	360 Aspen	

# Laurel Bay Underground Storage Tank Assessment Reports for: (153 addresses/161 tanks) cont.

655 Camellia	920 Albacore
662 Camellia	922 Barracuda Tank 1
683 Camellia	922 Barracuda Tank 2
684 Camellia	924 Albacore
689 Abelia	925 Albacore
694 Abelia	926 Albacore
695 Abelia	930 Albacore
741 Blue Bell	931 Albacore
742 Blue Bell	933 Albacore
755 Althea	936 Albacore
757 Althea	938 Albacore
776 Laurel Bay	939 Albacore
777 Azalea	940 Albacore
779 Laurel Bay	1010 Foxglove
781 Laurel Bay	1066 Gardenia
802 Azalea	1068 Gardenia
816 Azalea	1071 Heather Tank 2
822 Azalea	1100 Iris Tank 2
823 Azalea	1128 Iris
825 Azalea	1178 Bobwhite
828 Azalea	1204 Cardinal
837 Azalea	1208 Cardinal
851 Dolphin	1209 Cardinal
856 Dolphin	1210 Cardinal
857 Dolphin	1215 Cardinal
861 Dolphin	1216 Cardinal
864 Dolphin	1217 Cardinal Tank 1
868 Dolphin	1217 Cardinal Tank 2
872 Dolphin	1233 Dove
879 Cobia	1244 Dove
886 Cobia	1250 Dove
888 Cobia	1252 Dove
889 Cobia	1254 Dove
901 Barracuda	1256 Dove
902 Barracuda	1258 Dove
903 Barracuda	1263 Dove
904 Barracuda	1269 Dove
909 Barracuda	1276 Dove
910 Barracuda	1283 Dove
914 Barracuda	1285 Dove
915 Barracuda	1288 Eagle

# Laurel Bay Underground Storage Tank Assessment Reports for: (153 addresses/161 tanks) cont.

1296 Eagle	1330 Albatross
1307 Eagle	1331 Albatross
1321 Albatross	1333 Albatross
1322 Albatross	1334 Albatross
1327 Albatross	1335 Albatross
1328 Albatross	